Serre-câbles pour câble anti-torsion
Anti-torque cable clamps
Réf / *Part#: 7321, 7322, 7323, 7324*

Réf 9400
Index B / 2023

Réf / Part #	Ø cable / wire	A mm	B mm	L mm
7321	9	8.5	29	56
7322	11	10	31	60
7323	13	12	35	62
7324	15	15	40	100

ATTENTION: produit non structurel, ne convient pas pour le maintien du mât. **Utilisation uniquement pour enroulement de voiles**
WARNING: *non structural product, does not maintain the mast -* ***Only for furling sails.***

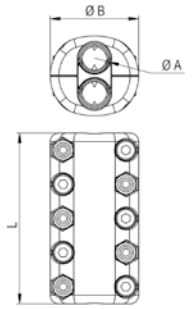

Recommandations:
• Pour une utilisation avec gennaker, il est impératif d'utiliser le cordage anti-torsion Marlow Prodrive 2.
• Pour une utilisation avec un spi asymétrique, le montage avec la plupart des câbles anti-torsion est possible

Recommendations:
• If used with gennaker or code 0, it is mandatory to fit the anti-torque cable clamps with the Marlow Prodrive2 anti-torque cable.
If used with asymetric spinnaker, most of the anti-torque cables of the market can be fitted with the clamps.

Materiel requis / ***Requested material:***

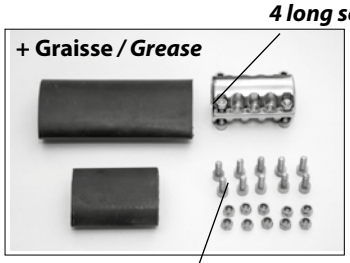

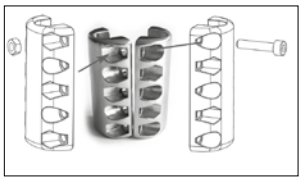

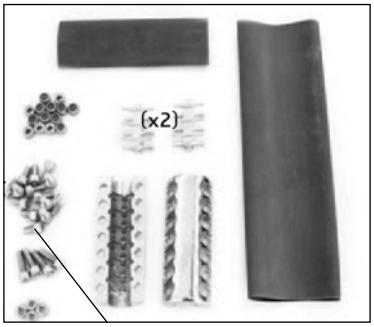

Réf / Part # 7324 / Dia 15
14 vis courtes */ 14 short screws*

Etape 1: Préparation / ***Step 1: reparation***

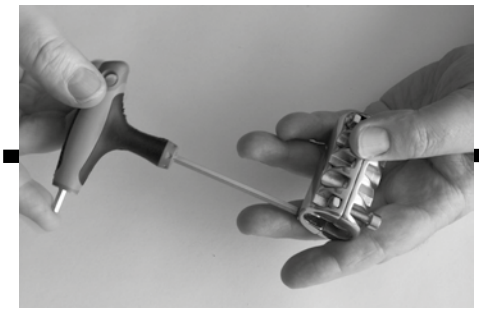

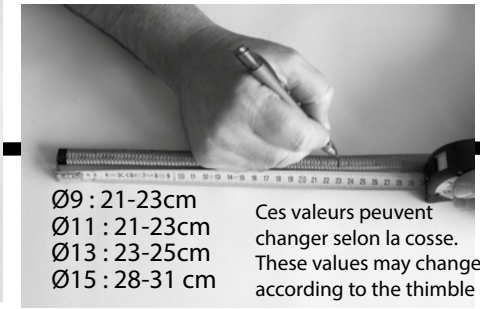

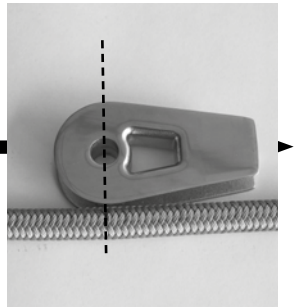

1. Enfiler les deux gaines thermorétractables dans le câble anti-torsion : d'abord le petit, puis le grand. *Thread the torque rope into the two shrinkable thermosleeves : the short first and then the bigger.* 2. Enlever les 4 vis longues du serre-câble. *Remove the 4 long screws from the cable clamp* 3. Positionner le câble anti-torsion autour de la cosse. *Put the anti-twist rope around the thimble. 4.* Positionner le serre-cable entre les 2 brins. *Place the clamp between the 2 lines*

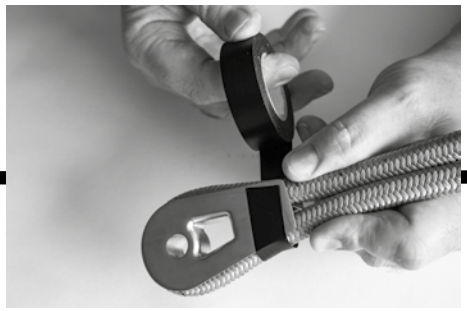

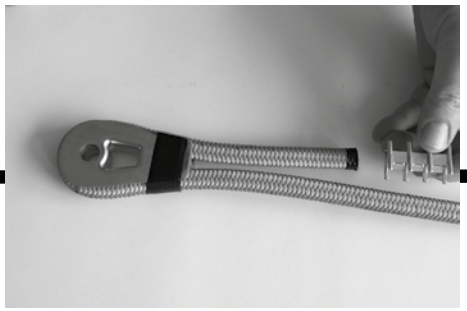

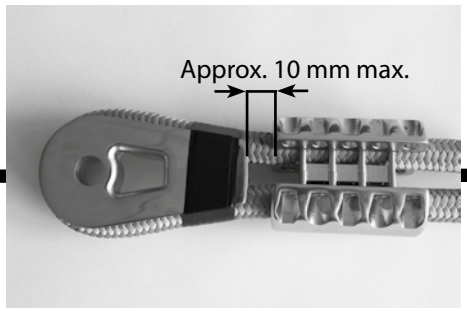

Etape 2 : Montage sans etau / ***Step 2: Fitting without a vice***

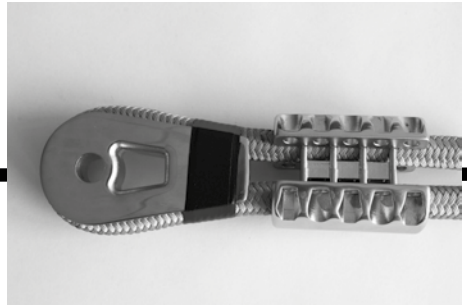

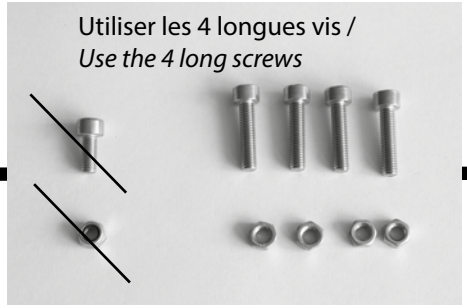

Coté opposé et procéder en croix pour uniformiser le serrage / Opposite side and *tighten progressively the screws as indicated above*

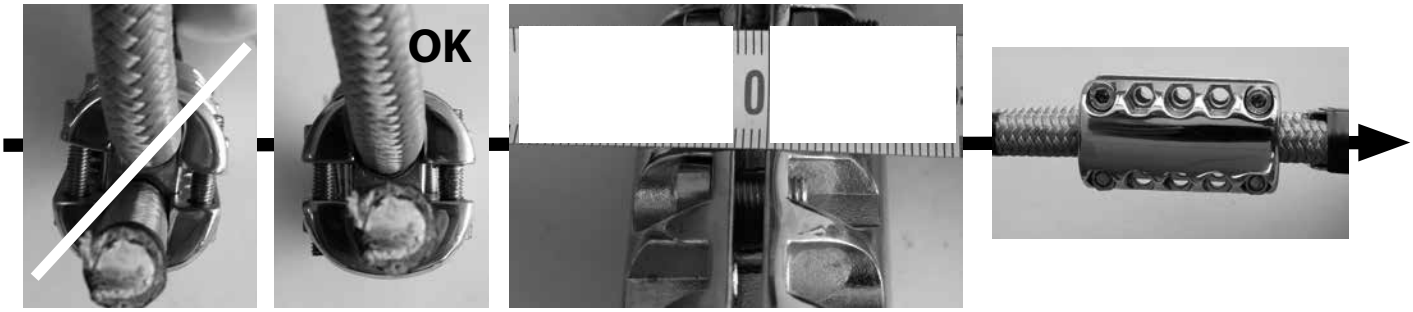

Installation définitive du serre-câble / *Complete clamp installation*

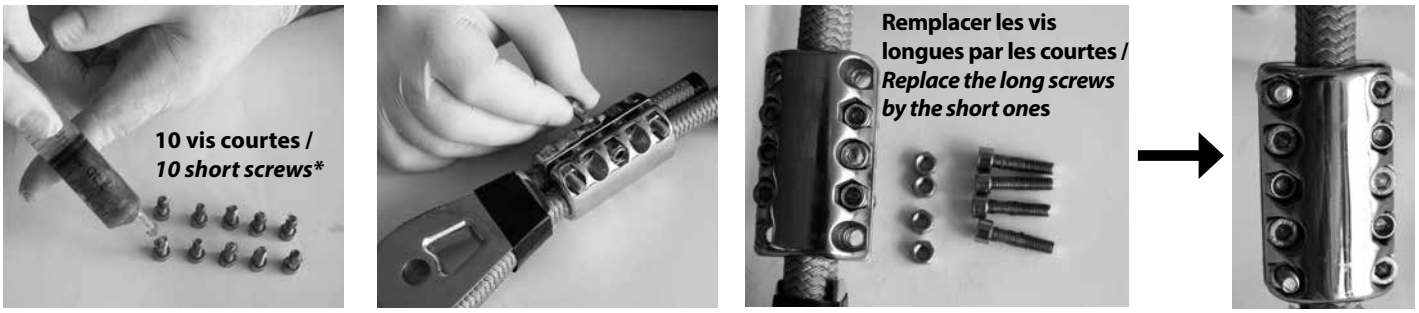

* Pour réf 7324: 14 vis courtes / *For part # 7324: 14 short screws*

Etape 2bis : Installation avec un étau / *Step 2bis : Installation with a vice*

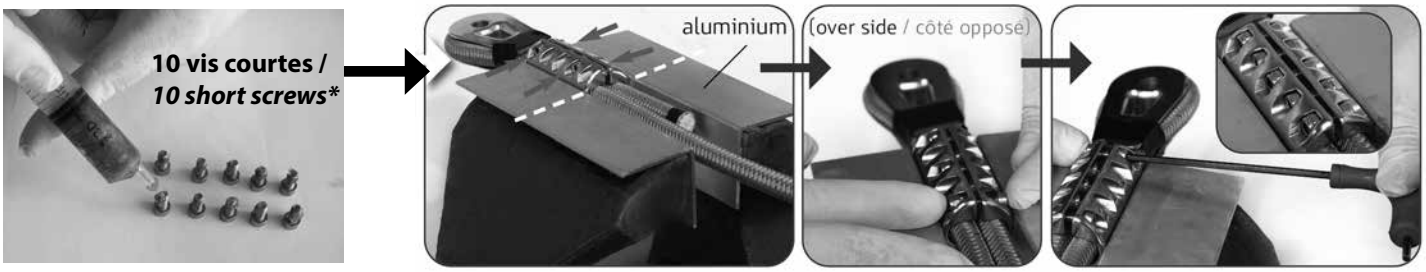

* Pour réf 7324: 14 vis courtes / *For part # 7324: 14 short screws*

Etape 3 : Serrage final / *Step 4: Tightening*

Etape 4 : Finition (gaine thermo-rétractable) / *Step 5 : Final fitting (shrinkable thermo-sleeve)*

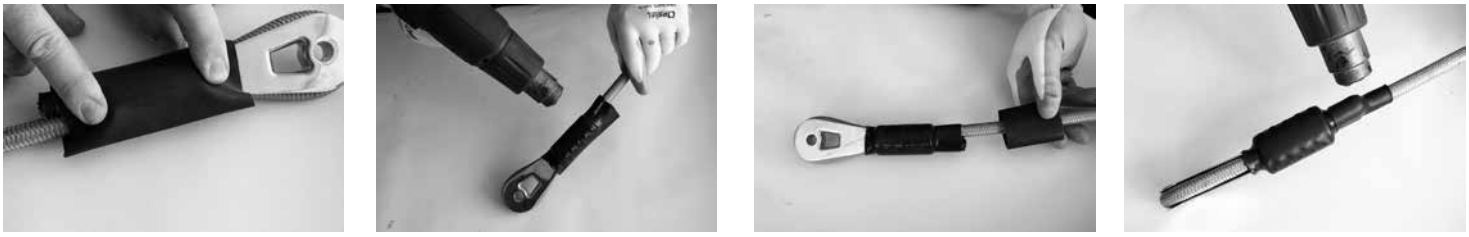

Contact: Wichard SAS
1 ZI de Felet CS 50085, 63307 Thiers Cedex France
E-mail: marine@wichard.com - Tel: +33 4 73 51 65 00

Contact Support Technique - *Technical support*
E-mail: hotline@wichard.com
Tel: +33 2 51 76 00 35